

PoE PSE Controller

Introduction

The Microchip family of PSE controllers include the PD69200, PD69210, and PD69220 devices. The PD69200 controller is based on the NXP Kinetis® L family, MKL15Z128VFM4. The PD69210 and PD69220 are based on the Microchip SAM D21 family. The PD69200 and PD69220 are pin compatible with an identical feature set. The PD69200 is available for existing designs. The PD69210 and PS69220 are recommended for all new designs.


When paired with the Microchip PD69208T4, PD69204T4, or PD69208M Managers, the PD69200 controller is part of a Power over Ethernet Power Source Equipment (PSE) system. This system enables designers to integrate enhanced mode PoE capabilities, as specified in IEEE 802.3af, IEEE 802.3at, IEEE 802.3bt, and PoH standards.

The PD69200 is available in a 32-pin, 5 mm x 5 mm QFN package.

Typical PoE Application

The following figure shows the typical PoE application of PD69208T4 and PD69200 devices.

Figure 1. Typical PoE Application

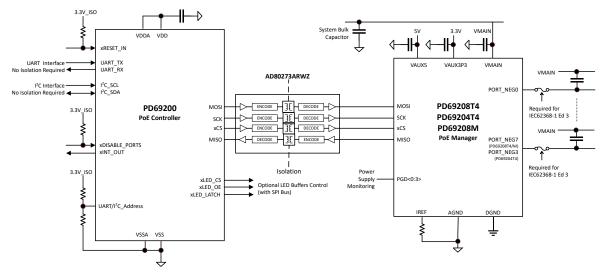

Consult Microchip AN3361 Designing an IEEE 802.3af/802.3at/802.3bt-Compliant PD69208 48-Port PoE System for complete reference design.

Datasheet DS00003460A-page 1 © 2020 Microchip Technology Inc.

Features

The following is the list of feature details of PSE Controller devices.

- Complies with IEEE 802.3 af/at, IEEE 802.3 bt, and HDBaseT (POH) standards
- Port matrix and priority
- Cascade up to 12 PoE devices for 48 logical ports
- 45 W maximum two pair power and capable of 90 W per four pair port (.bt)
- Supports three power management modes: Class (LLDP), Dynamic, and Static
- Supports 16 power banks based on four power supplies
- Port power limit setting
- Interrupt from power supply to PoE drivers
- Interrupt out pin for system and port events
- System OK indication
- Disable ports input pin
- System and port status and port measurements
- Legacy detection support
- LED stream support
- Fast and perpetual PoE support
- Software download through I²C or UART communication interface
- 32-pin, 5 mm x 5 mm QFN package
- Pin compatible with PD69220
- MSL3 and RoHS compliant

Table of Contents

Intr	troduction	1
	Typical PoE Application	1
	Features	2
1.	Architecture	4
••	1.1. Firmware	
	1.2. Communication	
	1.3. GUI	
	1.4. Software Library	
	1.5. SPI Communication	
	1.6. UART	5
	1.7. I ² C	5
	1.8. UART - I ² C Address Selection	6
2.	Electrical Specifications	7
	2.1. Electrical Characteristics	7
	2.2. Immunity	7
	2.3. Absolute Maximum Ratings	8
3.	Pin Descriptions	9
	3.1. Pin Configuration and Pinout	
	3.2. Pin Details	
	3.3. Recommended PCB Layouts	
4.	Package Information	13
	4.1. PD69200 Package Outline Drawing	
	4.2. Thermal Specifications	
	4.3. Recommended Solder Reflow Information	
	4.4. Reference Documents	15
5.	Ordering Information	16
6.	Revision History	17
	6.1. Revision 1.0	
The	ne Microchip Website	18
	oduct Change Notification Service	
	ustomer Support	
Mic	icrochip Devices Code Protection Feature	18
Leg	gal Notice	18
Tra	ademarks	19
Qua	uality Management System	19
Wo	orldwide Sales and Service	20


1. Architecture

The following figures shows the simplified hardware and the firmware architecture of the PoE system based on the PD69200 controller and the PD69208T4, PD69204T4, and PD69208M managers.

Figure 1-1. Simplified Hardware Architecture



Figure 1-2. Simplified Firmware Architecture

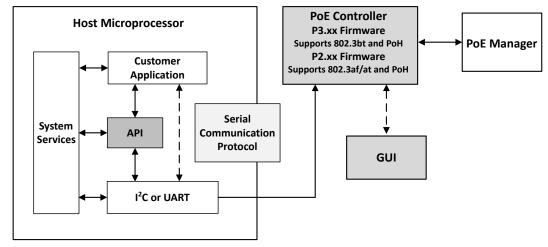

- · Dark grey boxes indicate Microchip supplied firmware
- · Light grey boxes indicate Microchip provided documentation
- · White boxes are user supplied

1.1 Firmware

- Firmware is pre-programmed in PD69200 controller. The firmware version is identifiable via the IC ordering part number.
- Firmware is vendor agnostic with regards to the choice of the host controller.
- May operated "stand alone" or with I²C or UART communication to host.
- The default profiles are coded into the firmware. Microchip offers a configuration tool for profile modification.
- Firmware is field-upgradeable via the I²C or UART link.

1.2 Communication

Communication between the host application and the controller's firmware may be done via a 15 byte protocol. Customers may use a Microchip provided API. Microchip provides a Serial Communication Protocol guide.

1.3 **GUI**

This is a diagnostic tool to control the Microchip PSE emulating or bypassing the host processor.

1.4 Software Library

The firmware (without the boot section), GUI, and API is available on Microchip's software library https://www.microchip.com/doclisting/SoftwareLib.aspx.

1.5 SPI Communication

The PD69208T4, PD69204T4, and PD69208M managers use SPI communication in SPI slave mode to communicate with the various controllers. Each manager has an address determined by ADDR0-ADDR3 pins. Each controller can support up to 12 ICs at addresses 0–11. The actual frequency between PD69200 and PD6920x ICs is 1 MHz.

The following table lists the SPI communication packet structure.

Table 1-1. SPI Communication - Packet Structure

Control Byte Selects PD69208T4 According to Address	R/W Bit	Internal Register Address	(Read Access Only)	Data Written to IC (Write Access Only) Read from IC (Read Access Only)
8 bits	R(0)/W(1)	8 bits	8 bits	16 bits

See the PD69208T4, PD69204T4, and PD69208M Manager datasheet for additional details on the SPI interface.

1.6 UART

A pull-up resistor is required on the UART communication line. For more information, see AN3361 Designing an IEEE802.3af/at/bt PoE System Based on PD692x0/PD69208.

Following is the UART communications configuration setting details:

• Bits per second: 19,200 bps

Data bits: 8Parity: NoneStop bits: 1

· Flow control: None

1.7 I²C

The PD69200 requires the host to support I²C clock stretch.

Following is the I²C communication configuration setting details:


· Address: 7 bits

Clockstretch: host should supportTransaction: 15 bytes or 1 byte

1.8 UART - I²C Address Selection

The choice of UART or I^2C interface between the host CPU is made by applying a specific voltage level to pin #22 (I2C_ADDR_MEAS) on the PD69200. Additionally, the specific I^2C address is also set by this voltage level. The voltage is set via an external resistor as shown in the following figure.

Figure 1-3. I²C Address Selection

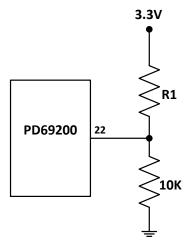

The following table shows the specific values of R to choose UART or I²C and to set the address.

Table 1-2. I²C Address Selection for PD69200

I2C_ADDR Voltage Low Level (V)	I2C_ADDR Voltage High Level (V)	I ² C Address (Hexadecimal)	R1- KΩ (1%)
0	0.21	UART	N.C.
0.21	0.41	0x4	97.6
0.41	0.62	0x8	53.6
0.62	0.83	0xC	35.7
0.83	1.03	0x10	25.5
1.03	1.24	0x14	19.1
1.24	1.44	0x18	14.7
1.44	1.65	0x1C	11.3
1.65	1.86	0x20	8.87
1.86	2.06	0x24	6.81
2.06	2.27	0x28	5.23
2.27	2.48	0x2C	3.92
2.48	2.68	0x30	2.80
2.68	2.89	0x34	1.87
2.89	3.09	0x38	1.02
3.09	3.30	0x3C	0.324

2. Electrical Specifications

For a complete list of electrical ratings and characteristics, see NXP KL15P80M48SF0 KL15 Sub-Family Data Sheet.

2.1 Electrical Characteristics

The following table list typical value conditions of PD69200.

Table 2-1. Typical Value Conditions

Symbol	Parameter	Min Typ	Value	Max	Units
T _A	Ambient temperature	-40	25	85	°C
V_{DD}	3.3 V supply voltage	3.0	3.3	3.63	V

2.2 Immunity

The following table lists the immunity conditions of PD69200.

Table 2-2. PD69200 Immunity

Symbol	Parameter	Conditions	Min	Max	Units
ESD	ESD rating	HBM ¹	-2000	2000	V
	ESD rating	CDM ²	-500	500	V

Note:

- 1. Determined according to JEDEC Standard JESD22-A114, *Electrostatic Discharge (ESD) Sensitivity Testing Human Body Model (HBM)*.
- 2. Determined according to JEDEC Standard JESD22-C101, Field-Induced Charged-Device Model Test Method for Electrostatic-Discharge-Withstand Thresholds of Microelectronic Components.

2.3 Absolute Maximum Ratings

Stresses beyond those listed in this section may cause permanent damage to the device. This is a stress rating only and functional operation of the device at these or other conditions beyond those indicated in the operational sections of this specification is not implied. Exposure to absolute maximum rating conditions for extended periods may affect the device reliability.

Table 2-3. Absolute Maximum Ratings

Symbol	Parameter	Minimum	Maximum	Units
V_{DD}	Digital supply voltage	-0.3	3.8	V
V _{DDA}	Analog supply voltage	VDD-0.3	VDD+0.3	V
V_{DIO}	Digital pin input voltage (Except RESET)	-0.3	3.6	V
V _{AIO}	Analog pins ¹ and RESET pin input voltage	-0.3	VDD+0.3	V
Lead Soldering Temperature (40 s, reflow)			260	°C
Storage Temperature		-55	150	°C

Note:

1. Analog pins are defined as pins that do not have an associated general purpose I/O port function.


3. Pin Descriptions

The following section describes the 32 pins of PD69200.

3.1 Pin Configuration and Pinout

The following figure shows the top view of PD69200.

Figure 3-1. PD69200 Pin Diagram

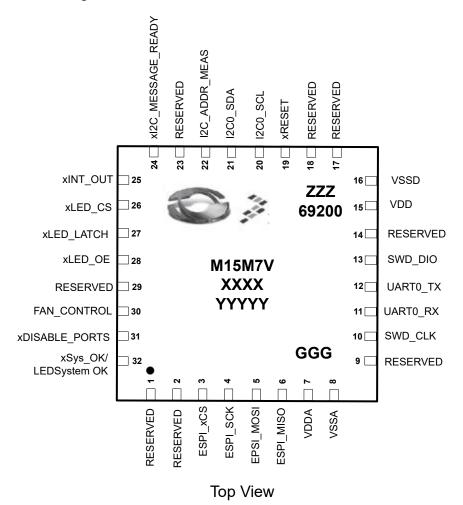

Note: For definitions about markings in the pinout diagram, see Ordering Information.

3.2 Pin Details

The following tables describe the functional pin descriptions of the PD69200 device.

Table 3-1. PD69200 Pin Description

Number	Designation	Туре	Description
1	Reserved	OUT	Reserved UART - Leave Open
2	Reserved	IN	Reserved UART - Pull up to 3.3 V via 10K
3	ESPI_xCS	OUT	ESPI Bus to PoE Manager. SPI chip select. Pull-up required. See <i>AN3361</i> for pin connection requirements. (Active Low)
4	ESPI_SCK	OUT	ESPI Bus to PoE Manager. SPI clock output to PD6920x, and LED stream clock output, set to 1 MHz.
5	ESPI_MOSI	OUT	ESPI Bus to PoE Manager. SPI Master Out Slave In. SPI packets are transmitted on this line.
6	ESPI_MISO	IN	ESPI Bus to PoE Manager. SPI Master In Slave Out. SPI packets are received on this line.
7	VDDA	Supply	Main Supply 3.3 V
8	VSSA	GND	Ground
9	Reserved	Analog_IN	Reserved Analog_IN. Connect to 3.3 V.
10	SWD_CLK		Leave Open
11	UART0_RXx	IN	UART receive from host. 15-byte protocol commands are received on this line. The baud rate is set to 19,200 bps. A pull up is required. See <i>AN3361</i> for details.
12	UART0_TX	OUT	UART transmit to host. 15-byte protocol reply/ telemetry is transmitted on this line. The baud rate is set to 19,200 bps.
13	SWD_DIO		Leave Open
14	Reserved	Analog_IN	Reserved Analog_IN. Connect to 3.3 V or GND through 10 k Ω .
15	VDD	Supply	Main Supply 3.3 V
16	VSSD	GND	Ground
17	Reserved	Oscillator	Reserved – Oscillator input – Leave open
18	Reserved	Oscillator	Reserved – Oscillator output – Leave open
19	xRESET	IN/OUT	Host Reset input. This pin is active low. The controller can generate self-reset. In this case, the xRESET pin is driven low by the controller for about 100 µs. See <i>AN3361</i> for pin connection requirements.

conti	continued					
Number	Designation	Туре	Description			
20	I2C0_SCL	IN/OUT	I ² C clock from the host master. Speed is limited to 400 KHz. Clock stretch required. Pull-up required, see <i>AN3361</i> for details.			
21	I2C0_SDA	IN/OUT	I ² C bidirectional data. 15-byte protocol messages are transmitted on this line. A pull up is required. See <i>AN3361</i> for more details.			
22	I2C_ADDR_MEAS	Analog_IN	Analog input to determine I ² C address or UART operation.			
23	Reserved		Connect to GND			
24	xI2C_MESSAGE_READY	OUT	I ² C message ready for reading by the host. The controller asserts this line low when it has an answer to the host. Therefore, the host can poll this line and initiate an I ² C read cycle only when the message is ready. This pin is active low. After the host reads the data from the controller, this pin is asserted to high.			
25	xINT_OUT	OUT	Interrupt output indication. This line is asserted low when a pre-configured event is in progress. This pin is active low.			
26	xLED_CS	OUT	Chip select signal for LED stream. This pin is active low.			
27	xLED_LATCH	OUT	Latch signal for LED stream. This pin is active low.			
28	xLED_OE	OUT	Output enable signal for LED stream. This pin is active low.			
29	Reserved	Analog_IN	Reserved Analog_IN. Connect to 3.3 V.			
30	FAN_CONTROL	OUT	Logic out that may be used to control a fan driver. This pin is active high.			
31	xDISABLE_PORTS	IN	Disable all PoE ports. When this input is asserted low, the controller shuts down all of the PoE ports in the system. See <i>AN3361</i> for pin connection requirements. (Active Low)			
32	xSys_OK/LED System OK	OUT	System validity indication. The behavior of this output is controlled by individual software mask. (Active Low)			
ePAD	ePAD		Connect to VSSA. Sufficient copper mass is needed to ensure adequate thermal performance.			

3.3 Recommended PCB Layouts

3.3.1 Recommended PCB Layout for 32-Pin QFN 5 mm x 5 mm

The following figures show the PCB layout pattern for PD69200. The units are in mm.

Figure 3-2. Top Layer Copper PCB Layout


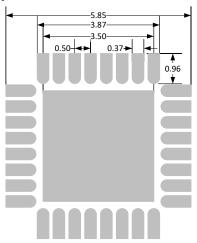


Figure 3-3. PD69200 Top-Layer Solder Paste and Vias PCB Layout for Thermal Pad Array

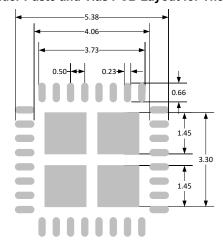

The contract manufacturer has latitude to modify the solder paste stencil for manufacturability reasons. The solder paste stencil covers 65% to 80% of the thermal pad and must not allow solder to be applied to the thermal vias under the QFN package using any method they deem appropriate. Any design should be subject to system validation and qualification prior to commitment to mass production of field deployment. Use a 5 mil stencil.


4. Package Information

This section describes the package drawings of PD69200 device.

4.1 PD69200 Package Outline Drawing

The following figure shows the package drawing (32 Pin QFN 5 mm x 5 mm) of the PD69200 device.

Figure 4-1. PD69200 Package Outline Drawing

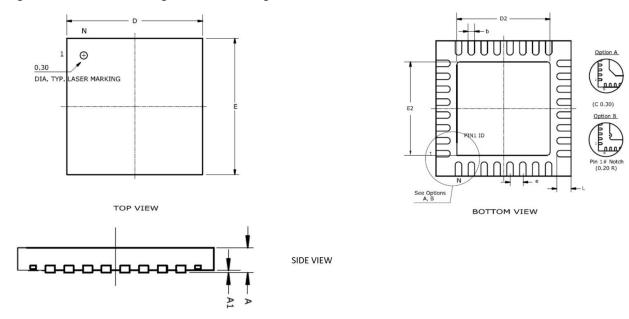

The following table lists the dimensions and measurements of the PD69200 package.

Table 4-1. PD69200 Package Outline Dimensions and Measurements

Dimension	Millimeters		Inches	
	Min	Max	Min	Max
Α	0.80	1.00	0.031	0.039
A1	0.00	0.05	0	0.002
е	0.50 BSC		0.02 BSC	
L	0.30	0.50	0.012	0.02
b	0.18	0.30	0.007	0.012
D2	3.50	3.70	0.138	0.147
E2	3.50	3.70	0.138	0.147
D	5.00 BSC		0.197 BSC	
Е	5.00 BSC		0.197 BSC	

Note: Dimensions do not include protrusions. They should not exceed 0.155 mm (.006 in) on any side. Lead dimension should not include solder coverage. The dimensions are in millimeters and inches for reference.

4.2 Thermal Specifications

The following table list the thermal specifications of the PD69200.

Table 4-2. Thermal Specifications

Thermal Resistance	Тур	Units	Notes
θ_{JA}	33	°C/W	Junction-to-ambient thermal resistance
θ_{JC}	1.8	°C/W	Junction-to-case thermal resistance

4.3 Recommended Solder Reflow Information

Following list shows the recommended solder reflow information details.

- RoHS 6/6
- Pb-free 100%
- Matte Tin Finish
- Package Peak Temperature for Solder Reflow (40 s maximum exposure)—260 °C (0 °C, -5 °C)

Table 4-3. Classification Reflow Profiles

Profile Feature	Sn-PbEutectic Assembly	Pb-Free Assembly
Average Ramp-up Rate (TS _{max} to Tp)	3 °C/second max	3 °C/second max
Preheat		
Temperature Min (TS _{min})	100 °C	150 °C
Temperature Max (TS _{max})	150 °C	200 °C
Time (ts _{min} to ts _{max})	60 s to 120 s	60 s to 180 s
Time Maintained		
Time Maintained Temperature (T _L)	183 °C	217 °C
Time (t _L)	60 s to 150 s	60 s to 150 s
Peak Classification Temperature (TP)	210 °C to 235 °C	240 °C to 255 °C
Time within 5 °C of Actual Peak Temperature (tp)	10 s to 30 s	20 s to 40 s
Ramp-down Rate	6 °C/second max	6 °C/second max
Time 25 °C to Peak Temperature	6 minutes max	8 minutes max

Figure 4-2. Classification Reflow Profiles

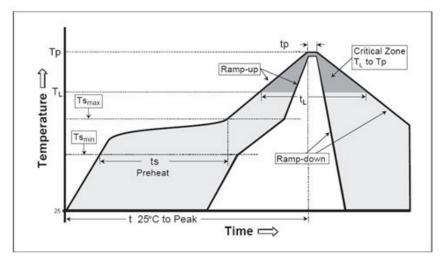


Table 4-4. Pb-Free Process—Package Classification Reflow Temperatures

Package Thickness	Volume mm ³ < 350	Volume mm ³ 350– 2000	Volume mm ³ > 2000
Less than 1.6 mm ¹	260 + 0 °C	260 + 0 °C	260 + 0 °C
1.6 mm to 2.5 mm ¹	260 + 0 °C	250 + 0 °C	245 + 0 °C
Greater than or equal to 2.5 mm ¹	250 + 0 °C	245 + 0 °C	245 + 0 °C

Note:

1. Tolerance: The device manufacturer or supplier should assure process compatibility up to and including the stated classification temperature, meaning that the peak reflow temperature is 0 °C. For example, 260 °C to 0 °C, at the rated MSL value.

Note: Exceeding the ratings that are mentioned in the preceding table might cause damage to the device.

4.4 Reference Documents

- IEEE Std 802.3-2018 Clause 33 Power over Ethernet over 2-Pair and Clause 145 Power over Ethernet
- PD692x0 Communication Protocol User Guide
- AN3361 Designing an IEEE802.3af/at/bt PoE System Based on PD692x0/PD69208
- PD69208T4, PD69204T4, and PD69208M PoE PSE Manager Data Sheet
- PD69210 and PD69220 PoE PSE Controller Data Sheet

5. Ordering Information

The following table lists the part ordering information for PD69200 devices.

Table 5-1. Ordering Information

Part Number	Package	Packaging Type	Temperature	Part Marking	Tray Marking
PD69200D ¹ - VVVV ² SS ³	Plastic QFN 5 mm × 5 mm (32 lead)	Tray	–40 °C to 85 °C	Microsemi Logo NXP Logo 69200 M15M7V ⁴ XXXX ⁵ YYYY ⁶	PD69200- VVVVSS PD-OOOGabb ⁷ YYWW
PD69200D ¹ - VVVV ² SS ³ -TR	Plastic QFN 5 mm × 5 mm (32 lead)	Tape and Reel	–40 °C to 85 °C	Microsemi Logo NXP Logo 69200 M15M7V ⁴ XXXX ⁵ YYYY ⁶	

Note:

- 1. D stands for the detection method set as:
 - C = IEEE802.3 and pre-standard
 - -R = IEEE802.3 only
- 2. VVVV is firmware revision.
- 3. SS stands for firmware parameters options.
- 4. Short part number
- 5. Mask set
- 6. Date code
- 7. Operational part number

The firmware release note has all required information about how to specify the choice of VVVV and SS. Find the Firmware Release Notes in the Microchip Software Libraries, and register to My Microchip account to access the release notes.

Note: The package meets RoHS, Pb-free of the European Council to minimize the environmental impact of electrical equipment.

Note: Initial burning of controller's firmware is performed in the factory. Firmware upgrades can be performed by users using the communication interface. For more information, see TN-140 (Catalog Number: 06-0024-081).

6. Revision History

The revision history describes the changes that were implemented in the document. The changes are listed by revision, starting with the most current publication.

6.1 Revision 1.0

The PD69200 PoE PSE Controller was previously described in the following documents:

- PD69208T4 and PD69200 Datasheet Revision 6, September 2019, Document Number PD-000303603
- PD69204T4 and PD69200 Datasheet Revision 6, September 2019, Document Number PD-000303601
- PD69208M and PD69200 Datasheet Revision 6, September 2019, Document Number PD-000303451

Table 6-1. PD69200 Revision History

Doc Rev.	Date	Comments
Α	March 2020	This is the initial issue of this document.

The Microchip Website

Microchip provides online support via our website at http://www.microchip.com/. This website is used to make files and information easily available to customers. Some of the content available includes:

- **Product Support** Data sheets and errata, application notes and sample programs, design resources, user's guides and hardware support documents, latest software releases and archived software
- General Technical Support Frequently Asked Questions (FAQs), technical support requests, online discussion groups, Microchip design partner program member listing
- Business of Microchip Product selector and ordering guides, latest Microchip press releases, listing of seminars and events, listings of Microchip sales offices, distributors and factory representatives

Product Change Notification Service

Microchip's product change notification service helps keep customers current on Microchip products. Subscribers will receive email notification whenever there are changes, updates, revisions or errata related to a specified product family or development tool of interest.

To register, go to http://www.microchip.com/pcn and follow the registration instructions.

Customer Support

Users of Microchip products can receive assistance through several channels:

- · Distributor or Representative
- · Local Sales Office
- · Embedded Solutions Engineer (ESE)
- · Technical Support

Customers should contact their distributor, representative or ESE for support. Local sales offices are also available to help customers. A listing of sales offices and locations is included in this document.

Technical support is available through the website at: http://www.microchip.com/support

Microchip Devices Code Protection Feature

Note the following details of the code protection feature on Microchip devices:

- · Microchip products meet the specification contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is one of the most secure families of its kind on the market today, when used in the intended manner and under normal conditions.
- There are dishonest and possibly illegal methods used to breach the code protection feature. All of these
 methods, to our knowledge, require using the Microchip products in a manner outside the operating
 specifications contained in Microchip's Data Sheets. Most likely, the person doing so is engaged in theft of
 intellectual property.
- Microchip is willing to work with the customer who is concerned about the integrity of their code.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of their code. Code protection does not mean that we are guaranteeing the product as "unbreakable."

Code protection is constantly evolving. We at Microchip are committed to continuously improving the code protection features of our products. Attempts to break Microchip's code protection feature may be a violation of the Digital Millennium Copyright Act. If such acts allow unauthorized access to your software or other copyrighted work, you may have a right to sue for relief under that Act.

Legal Notice

Information contained in this publication regarding device applications and the like is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with

© 2020 Microchip Technology Inc. Datasheet DS00003460A-page 18

your specifications. MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION, INCLUDING BUT NOT LIMITED TO ITS CONDITION, QUALITY, PERFORMANCE, MERCHANTABILITY OR FITNESS FOR PURPOSE. Microchip disclaims all liability arising from this information and its use. Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Trademarks

The Microchip name and logo, the Microchip logo, Adaptec, AnyRate, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, chipKIT, chipKIT logo, CryptoMemory, CryptoRF, dsPIC, FlashFlex, flexPWR, HELDO, IGLOO, JukeBlox, KeeLoq, Kleer, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PackeTime, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TempTrackr, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, FlashTec, Hyper Speed Control, HyperLight Load, IntelliMOS, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, Vite, WinPath, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, BlueSky, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, EtherGREEN, In-Circuit Serial Programming, ICSP, INICnet, Inter-Chip Connectivity, JitterBlocker, KleerNet, KleerNet logo, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PICkit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, SAM-ICE, Serial Quad I/O, SMART-I.S., SQI, SuperSwitcher, SuperSwitcher II, Total Endurance, TSHARC, USBCheck, VariSense, ViewSpan, WiperLock, Wireless DNA, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2020, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.

ISBN: 978-1-5224-5921-7

Quality Management System

For information regarding Microchip's Quality Management Systems, please visit http://www.microchip.com/quality.

© 2020 Microchip Technology Inc. Datasheet DS00003460A-page 19



Worldwide Sales and Service

AMERICAS ASIAPACIFIC Corporato Office 2558 West Chandler Blvd. Charlotte AZ 85224-8199 China - Beijing Tel: 68-792-7270 Tel: 68-792-7270 Tel: 68-792-7270 China - Chengdu Tel: 68-79-805-5511 Tel: 68-79-806-55511 Tel: 68-79-806-55511 Tel: 68-79-809-5588 http://www.microchip.com/ Veb Address: Tel: 68-79-809-5888 http://www.microchip.com/ Veb Address: Tel: 68-79-809-5888 Tel: 68-79-809-5988 Tel: 68-79-809-				
Table 1-80-090-04444 Tel: 43-7242-2244-39 Tel: 480-792-7277 Tel: 480-792-7277 Tel: 480-792-7277 Tel: 480-792-7277 Tel: 480-868-7000 Tel: 480-792-7277 Tel: 480-868-5611 Tel: 490-482-8289 Tel: 480-482-8289 Tel: 480-482-828	AMERICAS	ASIA/PACIFIC	ASIA/PACIFIC	EUROPE
Chandler, AZ 85224-6199	Corporate Office	Australia - Sydney	India - Bangalore	Austria - Wels
Tel: 48-07-92-7200	2355 West Chandler Blvd.	Tel: 61-2-9868-6733	Tel: 91-80-3090-4444	Tel: 43-7242-2244-39
Fax: 480-782-7277 China - Chengdu Technical Support http://www.microchip.com/support Web Address: Tel: 862-86865-5511 http://www.microchip.com/support Web Address: Tel: 862-86865-5511 http://www.microchip.com/support Web Address: Tel: 862-868800-9888 Tel: 813-8680-9770 Attanta Tel: 862-868-9702-9880 Tel: 813-8680-3770 Tel: 678-957-9614 Tel: 862-768-9702-9880 Tel: 813-8680-3770 Tel: 678-957-9614 Tel: 862-8678-8702-9880 Tel: 813-8680-3770 Tel: 878-957-1455 China - Hongkhou Austin, TX Tel: 912-237-3370 China - Hongkhou Westborough, MA China - Nanjing Tel: 774-760-0087 Tel: 878-7872-8115 Tel: 812-8680-377-561-7906 Westborough, MA China - Nanjing Tel: 862-878-73-2460 Tel: 862-878-73-2460 China - Shanghai Tel: 862-8-858-902-7355 Tel: 862-8-858-9880 Tel: 863-8-858-9880 Tel: 863-8-868-923 Tel: 863-8-858-9880 Tel: 863-8-858	Chandler, AZ 85224-6199	China - Beijing	India - New Delhi	Fax: 43-7242-2244-393
Technical Support	Tel: 480-792-7200	Tel: 86-10-8569-7000	Tel: 91-11-4160-8631	Denmark - Copenhagen
Neth	Fax: 480-792-7277	China - Chengdu	India - Pune	Tel: 45-4450-2828
Tel: 88-2-8890-9588	Technical Support:	Tel: 86-28-8665-5511	Tel: 91-20-4121-0141	Fax: 45-4485-2829
Attanta	http://www.microchip.com/support	China - Chongqing	Japan - Osaka	Finland - Espoo
Atlanta	Web Address:	Tel: 86-23-8980-9588	Tel: 81-6-6152-7160	Tel: 358-9-4520-820
Duluth, GA	http://www.microchip.com	China - Dongguan	Japan - Tokyo	France - Paris
Tel: 678-957-9614	Atlanta	Tel: 86-769-8702-9880	Tel: 81-3-6880- 3770	Tel: 33-1-69-53-63-20
Fax: 678-957-1455	Duluth, GA	China - Guangzhou	Korea - Daegu	Fax: 33-1-69-30-90-79
Austin_TX	Tel: 678-957-9614	Tel: 86-20-8755-8029	Tel: 82-53-744-4301	Germany - Garching
Tel: 512-257-3370	Fax: 678-957-1455	China - Hangzhou	Korea - Seoul	Tel: 49-8931-9700
Deston Tel: 852-2943-5100 Tel: 862-3-7851-7906 Malaysia - Penang Tel: 49-7131-72400 Tel: 852-8473-2460 Tel: 60-4-227-8870 Tel: 49-721-825370 Tel: 49-721-825370 Tel: 60-4-227-8870 Tel: 49-721-825370 Tel: 630-285-0071 Tel: 86-532-8502-7355 Tel: 632-634-9055 Germany - Munich Tel: 49-721-825370 Tel: 630-285-0071 Tel: 86-21-3326-8000 Tel: 65-6334-8870 Fax: 49-89-627-144-0 Tel: 630-285-0075 China - Shenyang Tel: 86-24-334-2829 Tel: 86-24-334-2829 Tel: 86-24-334-2829 Tel: 86-24-334-2829 Tel: 86-24-334-2829 Tel: 86-25-338-8870 Tel: 98-6-27-144-4 Germany - Rosenheim Tel: 97-28-18-7423 Tel: 86-24-334-2829 Tel: 86-5-5-8864-2200 Tel: 886-5-77-8366 Tel: 99-89-85-354-560 Tel: 99-89-85-31-85-500 Tel: 97-29-744-7705 Tel: 98-89-85-31-85-800 Tel: 86-2-5-8864-2200 Tel: 86-2-2508-8600 Tel: 97-29-744-7705 Tel: 97-29-744-7705 Tel: 86-2-2508-8600 Tel: 39-0331-742611 Tel: 28-18-89-8933 Tel: 86-2-5-980-5300 Tel: 86-2-2508-8600 Tel: 39-0331-742611 Tel: 28-18-94-8938 Tel: 86-27-5980-5300 Tel: 86-2-2508-8600 Tel: 39-0331-466781 Tel: 39-18-332 Tel: 86-29-8833-7252 Tel: 86-2-8833-7252 Tel: 86-2-8833-7252 Tel: 86-2-8833-7252 Tel: 86-2-8833-7252 Tel: 86-2-8833-7252 Tel: 86-39-2388138 Tel: 86-592-2388138 Tel: 86-592-2388138 Tel: 86-756-3210040 Tel:	Austin, TX	Tel: 86-571-8792-8115	Tel: 82-2-554-7200	Germany - Haan
Westborough, MA	Tel: 512-257-3370	China - Hong Kong SAR	Malaysia - Kuala Lumpur	Tel: 49-2129-3766400
Tel: 774-760-0087	Boston	Tel: 852-2943-5100	Tel: 60-3-7651-7906	Germany - Heilbronn
Tel: 774-760-0087	Westborough, MA	China - Nanjing	Malaysia - Penang	Tel: 49-7131-72400
Tel: 68-532-8502-7355 Tel: 63-2-634-9065 Tel: 69-2-634-9065 Tel: 49-89-627-144-0 Tel: 49-80-627-144-0 Tel: 49-80-627-147-0 Tel: 49-80-827-147-0 Tel: 49-80-829-1 Tel: 49-80-829-1 Tel: 49-80-829-1 Tel: 49-80-829-1 Tel: 49-80-829-1	-	Tel: 86-25-8473-2460	Tel: 60-4-227-8870	Germany - Karlsruhe
Itasca, IL	Fax: 774-760-0088	China - Qingdao	Philippines - Manila	
Itasca, IL	Chicago	_	Tel: 63-2-634-9065	Germany - Munich
Tel: 630-285-0071 Fax: 630-285-0075 China - Shenyang Dallas Tel: 86-24-2334-2829 Tel: 86-35-77-8366 Tel: 86-24-2334-2829 Tel: 86-35-77-8366 Tel: 86-375-8864-2200 Tel: 86-75-8864-2200 Tel: 86-75-8864-2200 Tel: 86-75-8864-2200 Tel: 86-75-8864-2200 Tel: 86-7-213-7830 Tel: 972-9-744-7705 Tel: 98-72-9-744-7705 Tel: 99-9-44-7500 Tel: 99-9-44-8000 Tel: 99-9-44-7510 Norway - Trondheim Tel: 49-9-400-90 Tel: 99-844-7510 New York, NY Tel: 919-844-7510 New York, NY Tel: 919-844-7510 New York, NY Tel: 919-844-7510 Tel: 919-844-75				_
Fax: 630-285-0075	•	_	• •	Fax: 49-89-627-144-44
Dallas				
Tel: 972-818-7423 Tel: 96-755-8864-2200 Tel: 86-755-8864-2200 Tel: 86-72-213-7830 Tel: 972-918-2924 China - Suzhou Tel: 86-186-623-1526 Tel: 86-86-2-2508-8600 Tel: 39-0331-742611 Tel: 39-0331-742611 Tel: 248-848-4000 Tel: 36-27-5980-5300 Tel: 66-2-694-1351 Tel: 39-0331-466781 Tel: 39-0331-466781 Tel: 38-94-5983 Tel: 86-29-833-7252 Tel: 86-29-833-7252 Tel: 86-98-33-7252 Tel: 86-98-33-7252 Tel: 317-773-8323 China - Xiamen Noblesville, IN Tel: 317-773-8323 China - Zhuhai Tel: 317-773-5453 Tel: 86-756-3210040 Tel: 86-756-3210040 Tel: 98-756-3210040 Tel: 98-773-7800 Raleigh, NC Tel: 99-844-7510 New York, NY Tel: 63-1-36-6000 San Jose, CA Tel: 408-735-9110 Tel: 408-735-9110 Tel: 408-735-9110 Tel: 905-695-1980 Tel: 905-695-1980			Tel: 886-3-577-8366	
Tel: 972-818-7423 Tel: 96-755-8864-2200 Tel: 86-755-8864-2200 Tel: 86-72-213-7830 Tel: 972-918-2924 China - Suzhou Tel: 86-186-623-1526 Tel: 86-86-2-2508-8600 Tel: 39-0331-742611 Tel: 39-0331-742611 Tel: 248-848-4000 Tel: 36-27-5980-5300 Tel: 66-2-694-1351 Tel: 39-0331-466781 Tel: 39-0331-466781 Tel: 38-94-5983 Tel: 86-29-833-7252 Tel: 86-29-833-7252 Tel: 86-98-33-7252 Tel: 86-98-33-7252 Tel: 317-773-8323 China - Xiamen Noblesville, IN Tel: 317-773-8323 China - Zhuhai Tel: 317-773-5453 Tel: 86-756-3210040 Tel: 86-756-3210040 Tel: 98-756-3210040 Tel: 98-773-7800 Raleigh, NC Tel: 99-844-7510 New York, NY Tel: 63-1-36-6000 San Jose, CA Tel: 408-735-9110 Tel: 408-735-9110 Tel: 408-735-9110 Tel: 905-695-1980 Tel: 905-695-1980	Addison, TX	China - Shenzhen		
Detroit	Tel: 972-818-7423	Tel: 86-755-8864-2200	_	Tel: 972-9-744-7705
Detroit	Fax: 972-818-2924	China - Suzhou	Taiwan - Taipei	Italy - Milan
Novi, MI Tel: 248-848-4000 Tel: 86-27-5980-5300 Tel: 66-2-694-1351 Tel: 66-2-694-1351 Tel: 66-2-694-1351 Tel: 39-049-7625286 Tel: 39-049-7625286 Tel: 39-049-7625286 Tel: 31-416-690399 Roblesville, IN Tel: 317-773-8323 Tel: 86-592-238138 Tel: 317-773-8453 Tel: 86-756-3210040 Tel: 86-756-3210040 Tel: 949-462-9523 Fax: 949-462-9523 Fax: 949-462-9608 Tel: 91-273-7800 Raleigh, NC Tel: 91-844-7510 Rew York, NY Tel: 631-435-6000 San Jose, CA Tel: 408-735-9110 Tel: 408-436-4270 Canada - Toronto Tel: 905-695-1980			•	
Tel: 248-848-4000 Houston, TX Tel: 281-894-5983 Tel: 86-27-5980-5300 China - Xian Tel: 86-269-8833-7252 Indianapolis China - Xiamen Noblesville, IN Tel: 86-592-2388138 Tel: 86-592-2388138 Tel: 86-592-2388138 Tel: 86-756-3210040 Tel: 317-773-8453 Tel: 86-756-3210040 Tel: 317-773-8453 Tel: 86-756-3210040 Te				
Houston, TX	Tel: 248-848-4000	Tel: 86-27-5980-5300	_	Italy - Padova
Tel: 281-894-5983 Indianapolis China - Xiamen Noblesville, IN Tel: 86-592-2388138 Tel: 317-773-8323 China - Zhuhai Tel: 317-573-5453 Tel: 317-536-2380 Los Angeles Mission Viejo, CA Tel: 949-462-9523 Fax: 949-462-9608 Tel: 951-273-7800 Raleigh, NC Tel: 919-844-7510 New York, NY Tel: 631-435-6000 San Jose, CA Tel: 408-735-9110 Tel: 408-436-4270 Canada - Toronto Tel: 905-695-1980 Tel: 86-29-8833-7252 Tel: 84-28-5448-2100 Netherlands - Drunen Tel: 84-28-5448-2100 Norway - Trondheim Tel: 31-416-690340 Norway - Trondheim Tel: 47-72884388 Poland - Warsaw Tel: 48-22-3325737 Romania - Bucharest Tel: 40-21-407-87-50 Spain - Madrid Tel: 40-21-407-87-50 Spain - Madrid Tel: 34-91-708-08-90 Fax: 34-91-708-08-90 Fax: 34-91-708-08-90 Fax: 34-91-708-08-90 Tel: 46-31-704-60-40 Sweden - Stockholm Tel: 46-8-5090-4654 UK - Wokingham Tel: 44-118-921-5800 Fax: 44-118-921-5820	Houston, TX	China - Xian	Vietnam - Ho Chi Minh	_
Indianapolis	·	Tel: 86-29-8833-7252	Tel: 84-28-5448-2100	Netherlands - Drunen
Noblesville, IN Tel: 86-592-2388138 China - Zhuhai Tel: 317-773-8323 Tel: 317-773-5453 Tel: 86-756-3210040 Tel: 47-72884388 Tel: 47-72884388 Poland - Warsaw Tel: 48-22-3325737 Romania - Bucharest Tel: 40-21-407-87-50 Spain - Madrid Tel: 34-91-708-08-90 Raleigh, NC Tel: 919-844-7510 Norway - Trondheim Tel: 40-31-708-08-91 T	Indianapolis	China - Xiamen		Tel: 31-416-690399
Tel: 317-773-8323 Fax: 317-773-5453 Tel: 317-536-2380 Los Angeles Mission Viejo, CA Tel: 949-462-9523 Fax: 949-462-9608 Tel: 951-273-7800 Raleigh, NC Tel: 919-844-7510 New York, NY Tel: 631-435-6000 San Jose, CA Tel: 408-735-9110 Tel: 408-436-4270 Canada - Toronto Tel: 905-695-1980 China - Zhuhai Tel: 47-7284388 Poland - Warsaw Tel: 48-22-3325737 Romania - Bucharest Tel: 40-21-407-87-50 Spain - Madrid Tel: 40-1-708-08-90 Fax: 34-91-708-08-90 Fax: 34-91-708-08-91 Sweden - Gothenberg Tel: 46-31-704-60-40 Sweden - Stockholm Tel: 408-436-4270 Fax: 44-118-921-5820	•	Tel: 86-592-2388138		Fax: 31-416-690340
Fax: 317-773-5453 Tel: 86-756-3210040 Tel: 47-72884388 Tel: 317-536-2380 Poland - Warsaw Los Angeles Tel: 48-22-3325737 Mission Viejo, CA Romania - Bucharest Tel: 949-462-9523 Tel: 40-21-407-87-50 Fax: 949-462-9608 Spain - Madrid Tel: 951-273-7800 Tel: 34-91-708-08-90 Raleigh, NC Fax: 34-91-708-08-91 Tel: 919-844-7510 Sweden - Gothenberg New York, NY Tel: 46-31-704-60-40 Tel: 631-435-6000 Sweden - Stockholm Tel: 408-735-9110 Tel: 408-436-4270 Canada - Toronto Fax: 44-118-921-5800 Tel: 905-695-1980 Fax: 44-118-921-5820		China - Zhuhai		Norway - Trondheim
Los Angeles Tel: 48-22-3325737 Mission Viejo, CA Romania - Bucharest Tel: 949-462-9523 Tel: 40-21-407-87-50 Fax: 949-462-9608 Spain - Madrid Tel: 951-273-7800 Tel: 34-91-708-08-90 Raleigh, NC Fax: 34-91-708-08-91 Tel: 919-844-7510 Sweden - Gothenberg New York, NY Tel: 46-31-704-60-40 Tel: 631-435-6000 Sweden - Stockholm San Jose, CA Tel: 408-735-9110 Tel: 408-436-4270 UK - Wokingham Tel: 408-436-4270 Fax: 44-118-921-5800 Canada - Toronto Fax: 44-118-921-5820	Fax: 317-773-5453	Tel: 86-756-3210040		
Los Angeles Tel: 48-22-3325737 Mission Viejo, CA Romania - Bucharest Tel: 949-462-9523 Tel: 40-21-407-87-50 Fax: 949-462-9608 Spain - Madrid Tel: 951-273-7800 Tel: 34-91-708-08-90 Raleigh, NC Fax: 34-91-708-08-91 Tel: 919-844-7510 Sweden - Gothenberg New York, NY Tel: 46-31-704-60-40 Tel: 631-435-6000 Sweden - Stockholm San Jose, CA Tel: 408-735-9110 Tel: 408-436-4270 UK - Wokingham Tel: 408-436-4270 Fax: 44-118-921-5800 Canada - Toronto Fax: 44-118-921-5820	Tel: 317-536-2380			Poland - Warsaw
Mission Viejo, CA Tel: 949-462-9523 Fax: 949-462-9608 Tel: 951-273-7800 Raleigh, NC Tel: 919-844-7510 New York, NY Tel: 631-435-6000 San Jose, CA Tel: 408-735-9110 Tel: 408-436-4270 Canada - Toronto Tel: 905-695-1980 Romania - Bucharest Tel: 40-21-407-87-50 Spain - Madrid Tel: 40-21-407-87-50 Spain - Madrid Tel: 34-91-708-08-90 Fax: 34-91-708-08-91 Sweden - Gothenberg Tel: 46-31-704-60-40 Sweden - Stockholm Tel: 46-8-5090-4654 UK - Wokingham Tel: 448-118-921-5800 Fax: 44-118-921-5820				
Tel: 949-462-9523 Fax: 949-462-9608 Tel: 951-273-7800 Raleigh, NC Tel: 919-844-7510 New York, NY Tel: 631-435-6000 San Jose, CA Tel: 408-735-9110 Tel: 408-436-4270 Canada - Toronto Tel: 905-695-1980 Tel: 40-21-407-87-50 Spain - Madrid Tel: 34-91-708-08-90 Fax: 34-91-708-08-91 Sweden - Gothenberg Tel: 46-31-704-60-40 Sweden - Stockholm Tel: 46-8-5090-4654 UK - Wokingham Tel: 44-118-921-5800 Fax: 44-118-921-5820	<u>-</u>			Romania - Bucharest
Tel: 951-273-7800 Raleigh, NC Tel: 919-844-7510 New York, NY Tel: 631-435-6000 San Jose, CA Tel: 408-735-9110 Tel: 408-436-4270 Canada - Toronto Tel: 905-695-1980 Tel: 34-91-708-08-90 Fax: 34-91-708-08-91 Sweden - Gothenberg Tel: 46-31-704-60-40 Sweden - Stockholm Tel: 46-8-5090-4654 UK - Wokingham Tel: 44-118-921-5800 Fax: 44-118-921-5820				Tel: 40-21-407-87-50
Tel: 951-273-7800 Raleigh, NC Tel: 919-844-7510 New York, NY Tel: 631-435-6000 San Jose, CA Tel: 408-735-9110 Tel: 408-436-4270 Canada - Toronto Tel: 905-695-1980 Tel: 34-91-708-08-90 Fax: 34-91-708-08-91 Sweden - Gothenberg Tel: 46-31-704-60-40 Sweden - Stockholm Tel: 46-8-5090-4654 UK - Wokingham Tel: 44-118-921-5800 Fax: 44-118-921-5820	Fax: 949-462-9608			Spain - Madrid
Raleigh, NC Fax: 34-91-708-08-91 Tel: 919-844-7510 Sweden - Gothenberg New York, NY Tel: 46-31-704-60-40 Tel: 631-435-6000 Sweden - Stockholm San Jose, CA Tel: 46-8-5090-4654 Tel: 408-735-9110 UK - Wokingham Tel: 408-436-4270 Tel: 44-118-921-5800 Canada - Toronto Fax: 44-118-921-5820				·
Tel: 919-844-7510 New York, NY Tel: 46-31-704-60-40 Sweden - Stockholm San Jose, CA Tel: 408-735-9110 Tel: 408-436-4270 Canada - Toronto Tel: 905-695-1980 Sweden - Stockholm Tel: 46-31-704-60-40 Sweden - Stockholm Tel: 46-8-5090-4654 UK - Wokingham Tel: 44-118-921-5800 Fax: 44-118-921-5820				
New York, NY Tel: 46-31-704-60-40 Tel: 631-435-6000 Sweden - Stockholm San Jose, CA Tel: 46-8-5090-4654 Tel: 408-735-9110 UK - Wokingham Tel: 408-436-4270 Tel: 44-118-921-5800 Canada - Toronto Fax: 44-118-921-5820 Tel: 905-695-1980 Fax: 44-118-921-5820	<u> </u>			
Tel: 631-435-6000 San Jose, CA Tel: 408-735-9110 Tel: 408-436-4270 Canada - Toronto Tel: 905-695-1980 Sweden - Stockholm Tel: 46-8-5090-4654 UK - Wokingham Tel: 44-118-921-5800 Fax: 44-118-921-5820				_
San Jose, CA Tel: 46-8-5090-4654 Tel: 408-735-9110 UK - Wokingham Tel: 408-436-4270 Tel: 44-118-921-5800 Canada - Toronto Fax: 44-118-921-5820 Tel: 905-695-1980 Fax: 44-118-921-5820	•			
Tel: 408-735-9110 Tel: 408-436-4270 Canada - Toronto Tel: 905-695-1980 UK - Wokingham Tel: 44-118-921-5800 Fax: 44-118-921-5820				
Tel: 408-436-4270 Canada - Toronto Tel: 905-695-1980 Tel: 44-118-921-5820 Fax: 44-118-921-5820				
Canada - Toronto Fax: 44-118-921-5820 Tel: 905-695-1980 Fax: 44-118-921-5820				
Tel: 905-695-1980				